

Furnishings Plan

List of Recommended Furnishings with Room Plans

All recommended furnishings will date to the period of interpretation, 1924-42, for these historically furnished rooms.

34 Conductor's/Waiting Room Room 101

Originally conceived as a conductor's room and waiting room for the Kelso Depot, because of the low volume of passenger traffic at Kelso this room saw relatively little activity. Remodeled within a decade or so, the original waiting room bench appears to have been removed and shelving and mail slots added for company mail. Reflecting its limited use, the room will be sparsely furnished.


HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
101.1	Woodwork, varnish Paint color	Paint Analysis Report, varnish chronologies, room 101	Refinish to original 9.5 pt
101.2	Window sash varnish	Paint Analysis Report	Refinish to original
101.3	Painted walls, peach	Paint Analysis Report, Paint color chronologies, room 101, sample D-6/MOJA-P054	Paint walls: peach need Munsell #
101.4	Painted ceiling, peach	Paint Analysis Report, Paint color chronologies, room 101, sample D-23/MOJA-P071	Paint ceiling: peach need Munsell #
101.5	Floor, scored 12" concrete squares, maroon	HSR p. 231; Paint Analysis p. 4 and 6	Refinish to original maroon concrete
101.6	Ceiling light, in center	Figures 1, 9 and 20	Acquire shade (ARG) of ceiling

West wall

101.7	Roller shade, 1, off-white, on west window	Brackets extant at transom	Acquire reproduction
101.8	Radiator, below window on west wall	Figure 1	Omit. Installation would obstruct grilles of modern HVAC system.
101.9	Framed picture of western scene, on west wall	Figures 34 and 35; Kelso Club Inventory, 1953, p.9	Acquire

North wall

101.10	Shelf, built-in, across north side of room	Extant in room	Refinish to original varnish (ARG)
--------	--	----------------	------------------------------------

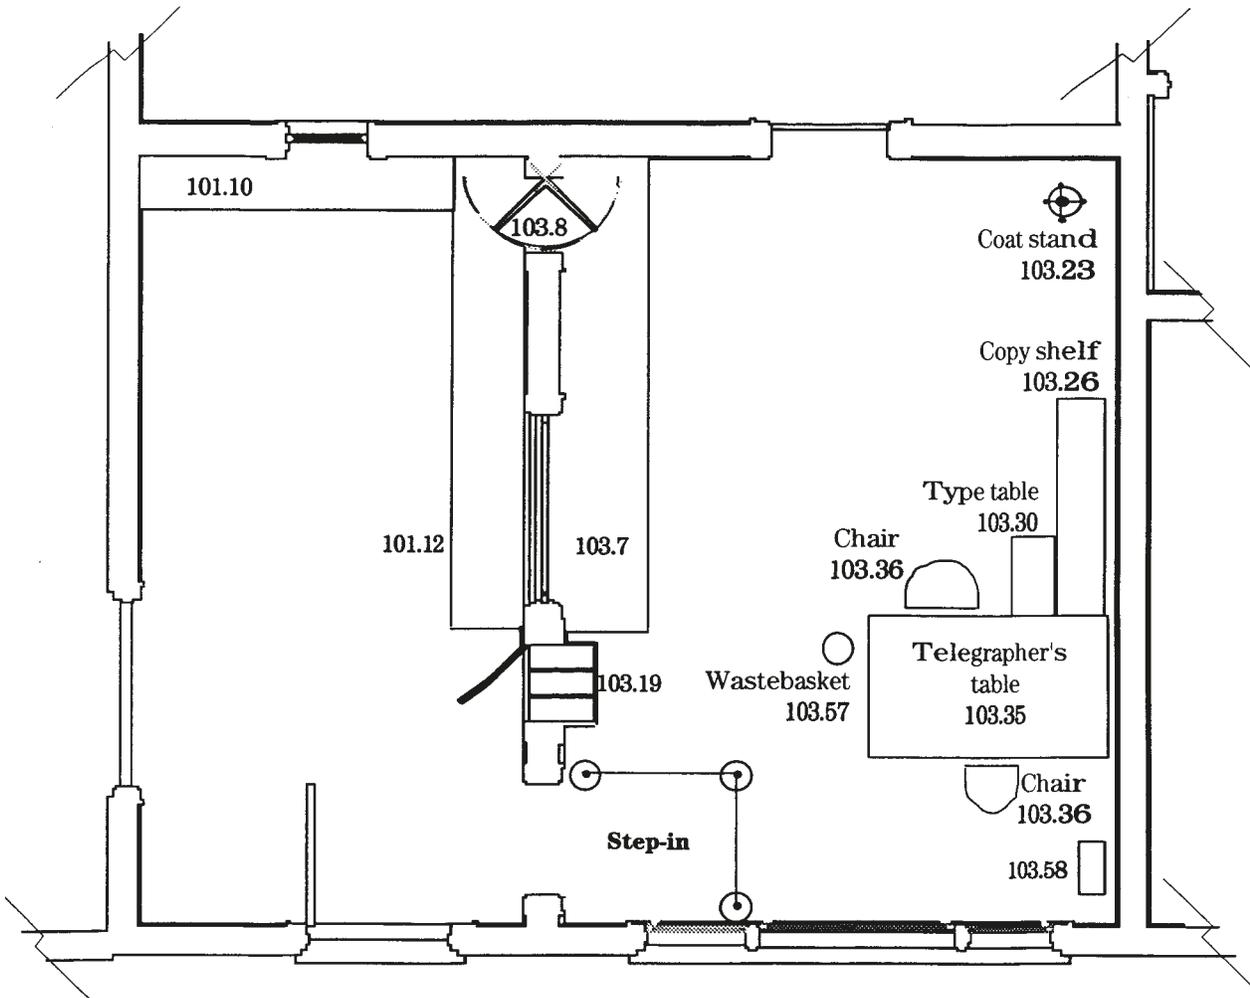

Room 101
Conductors/Waiting

Room 103
Ticket/Telegram

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
East wall			
101.11	Large framed photograph of western scene, east wall above ticket window	Large nail hole above ticket window; Figures 34 and 35; Kelso Club Inventory, 1953, p. 9	Acquire or reproduce
101.12	Shelf, on decorative wood brackets, along east wall	Extant in room	Refinish to original varnish (ARG)
101.13	Ticket window grate	Extant in room	Use extant grate
101.14	Mail boxes, 9	Extant in room	Refinish to original varnish (ARG)


Telegraph and Ticket Office Room 103

In the 1920s and 1930s the Kelso telegraph and ticket office saw steady use. While this plan presents the space furnished to sell passenger tickets the primary activity in the room centered on the telegrapher and his duties. The one photograph of the Kelso interior, which dates to 1955,¹³⁴ has been drawn upon heavily, as have interviews with the telegrapher in the image, Bob McCoy, and Bill Davis, who worked as telegrapher in Kelso in 1942-43.

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
103.1	Woodwork, varnish	Architectural Resources Group to Dennis Schramm, 1/18/01	Refinish to original varnish.
103.2	Window sash	Paint Analysis Report	Refinish to original varnish.
103.3	Painted walls, orange beige	Paint Analysis Report, Paint color chronologies, room 103, sample E-1/MOJA-P072	Paint walls: orange beige; need Munsell #
103.4	Painted ceiling, peach	Paint Analysis Report, Paint color chronologies, room 103, sample E-17/MOJA-P088	Paint ceiling: peach; need Munsell #
103.5	Floor, scored 12" concrete squares, maroon	HSR p. 231, Paint Analysis, p.4 and 6	Refinish to original maroon concrete.
103.6	Lights, hanging, 3, with white opaque shades, 1 above ticket window and other 2 centered at north and south ends of room	Figure 1	Acquire (ARG).
West Wall			
103.7	Ticket counter with cupboards below, built-in, on west wall from ticket window up to north wall	Figures 1 and 4	Refinish to original varnish.
103.8	Lazy-susan, quarter-round, with door and swing through to room 101 in northwest corner at end of counter	Architectural Resources Group to Dennis Schramm, 1/18/01	Refinish to original stain and varnish (ARG).
103.9	Telephone, on lazy susan at north end of ticket counter	Packard, Davis, McCoy, Francis	Acquire.
103.10	Ringer box, mounted on north wall	Packard, Davis, McCoy, Francis	Acquire.
103.11	Ticket grate	Extant in room	Use extant grate.
103.12	Blotter, in front of ticket window	Standard furnishing in 1920s-30s office	Acquire.

134 Display of a copy of this historic photograph so that visitors can view the image while also viewing the room would add considerably to understanding and appreciation of the telegraph office. The McCoy photograph would best be displayed in the visitor step-in which is from the same view point as the original photograph.

38

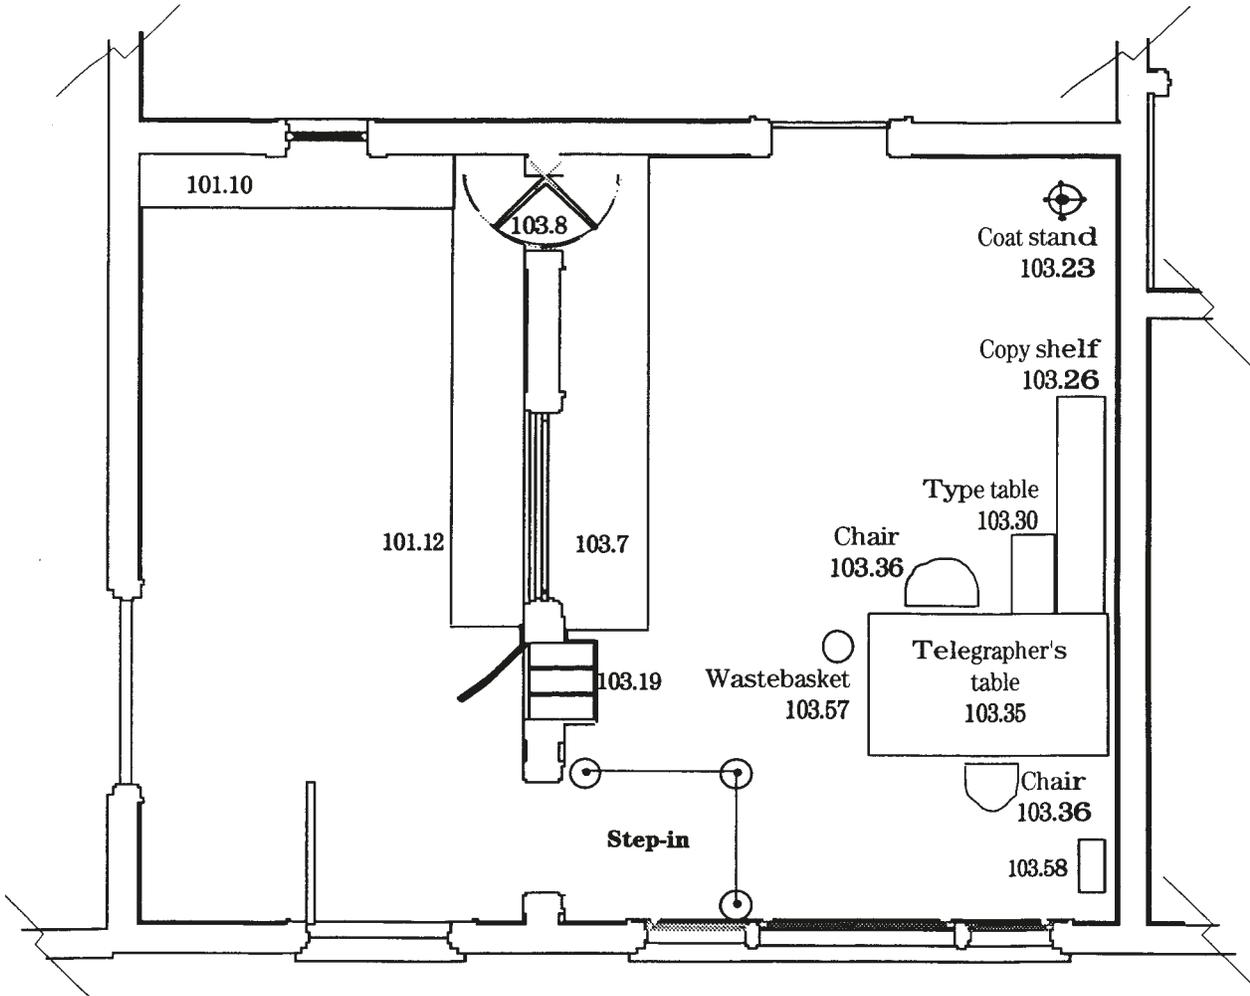

Room 101
Conductors/Waiting

Room 103
Ticket/Telegram

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
103.13	Ticket validator, on ticket counter	Davis	Acquire.
103.14	Papers — tickets, timetables on ticket counter	Standard furnishings in 1920s-30s ticket office	Acquire.
103.15	Pencils, on ticket counter	Standard furnishings in 1920s-30s ticket office	Acquire.
103.16	Note pad on ticket counter	Davis	Acquire.
103.17	Stamp rack with rubber stamps on ticket counter	Packard	Acquire.
103.18	Ash tray on ticket counter	Davis	Acquire.
103.19	Mail boxes, 9, and drop slot, built-in, at south end of ticket counter with name/department labels for each box	Architectural Resources Group to Dennis Schramm, 1/18/01	Refinish to original stain and varnish; acquire reproduction labels.
North Wall			
103.20	Calendar, Union Pacific, on north wall toward west end	Figure 36; Davis	Acquire.
103.21	Time table of employees, on north wall above calendar	Standard furnishings in 1920s-30s office	Acquire.
103.22	Poster, Union Pacific, safety, on north wall, east of door to room 102	Davis	Acquire.
103.23	Coat and hat rack, standing, in northwest corner of room	Sperry	Acquire.
103.24	Coat on coat rack	Standard furnishing in 1920s-30s office .	Acquire
East Wall			
103.25	Clock, standard, on east wall on extant board	Figure 1	Acquire.
103.26	Cupboard, along east wall, below clock board	Figure 7	Acquire.
103.27	Semaphore instrument on cupboard on east wall	Figure 7	Acquire.
103.28	Lamp, gooseneck, on semaphore instrument	Figure 7	Acquire.
103.29	Papers in binders, 2 open on top of shelf on east wall	Figure 7	Acquire.
103.30	Table south of cupboard on east wall	Figure 7	Acquire.
103.31	Typewriter on table	Figure 7	Acquire.
103.32	Extra typewriter ribbon, and paper near typewriter	Standard furnishing in 1920s-30s office	Acquire.

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
103.33	Notebooks or Shannon files, ring-bound, on shelves of cupboard on east wall	Figure 7	Acquire.
103.34	Clipboard with papers, on cupboard on east wall	Standard furnishing in 1920s-30s office	Acquire.
103.35	Desk, flat top, projecting out from west wall, south of cupboard with 2 hutches and glass divider on top	Figure 7; Davis	Acquire, approximately 5' x 4'.
103.36	Chairs, arm, 2, on casters with seat cushions, at each side of desk	Figure 7; Davis	Acquire.
103.37	Floor mat, at north side of desk under chair and part of desk	Davis	Acquire.
103.38	Train register, on top of hutch	Davis, Francis	Acquire.
103.39	Telegraph key, on desk	Figure 7	Acquire.
103.40	Telephone accordion extender, attached to hutch	Figure 7	Acquire.
103.41	Telephone on desk	Figure 7	Acquire.
103.42	Headset on desk	Figure 7	Acquire.
103.43	Sounder on desk	Figure 7	Acquire.
103.44	Prince Albert tobacco can, inverted in sounder	Figure 7	Acquire.
103.45	Papers and forms — blank train order forms, Western Union telegraph forms, clearance cards, Union Pacific telegraph forms, train order carbons in separate sections of hutch	Davis	Acquire.
103.46	Copies retained, in desk slot	Davis	Acquire.
103.47	Clearance cards, completed, stack and bound on desk	Davis	Acquire.
103.48	Time table on desk	Davis	Acquire.
103.49	Train order form, filled out, on desk	Figures 7 and 44	Acquire.
103.50	Stylus on desk by train order	Davis; figure 44	Acquire.
103.51	Ash tray and package of cigarettes on desk	Davis	Acquire.
103.52	Pencils on desk	Davis	Acquire.
103.53	Pencil holder on desk	Figure 44	Acquire.
103.54	Pens on desk		Acquire.
103.55	Pencil sharpener, mounted on corner of desk	Davis; figure 43	Acquire.

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
103.56	Stamp pad on desk	Figure 40; Davis	Acquire.
103.57	Wastebasket, wire mesh, filled with papers on floor at west end of desk	Davis	Acquire.
103.58	Train order hoops, 6, rigged with string and orders, set in wood block on floor by door in southwest corner	Davis, figures 47 and 48	Acquire. Placement in original location on south wall by door to room 101 is not possible due to visitor step-in. Locate along east wall at south end.
103.59	String, for hoops, cut to length, on nail by hoops in southwest corner	Figures 47 and 38	Acquire.

41

South Wall

103.60	Roller shades, 4, off-white		Acquire.
103.61	Radiator, centered below windows on south wall	Figure 1	Omit. Installation would obstruct grilles of modern HVAC system.
103.62	Brakemens' lanterns, kerosene, railroad, 2, 1 red, 1 white on floor by windows	Davis	Acquire.


Lobby Room 113

The lobby of the Kelso Depot will be the entrance to the visitors' center and will serve numerous park functions. As such, it cannot be fully historically furnished, however, the retention and addition of a number of key furnishings should contribute considerably to maintaining a historic atmosphere for both the room and building. Historic furnishings that will be impractical in the lobby in the 21st century have nonetheless been noted in the following plan, thus documenting the 1924-42 historic appearance as part of this *Historic Furnishings Report*.

Like the historic Union Pacific views that hung in various locations in the depot, the park may want to present a view of the Mojave Desert, framed and displayed in a similar manner, in the lobby perhaps on the north wall so visitors would see it as they go into the audiovisual area.

42

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
113.1	Woodwork, stained and	Paint Analysis, p. 4 varnished	Refinish to original stain and varnish.
113.2	Painted and varnished walls, buff beige	Paint Analysis, p. 4	Paint Munsell 2.5Y 8.5/4, varnish.
113.3	Painted ceiling, buff beige	Paint Analysis, p. 4	Paint Munsell 2.5Y 8.5/4, varnish
113.4	Floor, scored 12" concrete squares, maroon	Paint Analysis, pp. 4-5	Refinish to original maroon concrete.
113.5	Ceiling fan, four-blade, in center of lobby	Figures 2, 20-23 and 27	Acquire. (Supplied by construction contractor per ARG specifications)
113.6	Lights, 3, hanging, with white opaque shades	Figure 37 <i>HSR</i> ; figures 1 and 20	Acquire. (Supplied by construction contractor per ARG specifications)
West wall			
113.7	Room board, with hooks, on wall behind lobby counter on west wall	Francis	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact
113.8	Framed picture of western scene on west wall	Figures 34 and 35; Kelso Club Inventory, 1953	Acquire original in private collection or make reproduction of same original.
113.9	Wall sconces, 2, on west wall behind desk	Figure 1	Acquire. (Supplied by construction contractor per ARG specifications)
113.10	Clock, on west wall behind counter	Figure 1	Acquire; battery operated. Relocate from original north wall location due to adaptive reuse of lobby as visitors' center.
113.11	Counter, L-shaped, with display case by Weber Showcase & Fixture Company, in southwest corner of lobby	Figures 1, 2, 14 and 34; ICC Valuations p. 73/333	Use extant original counter; clean and conserve finish and marble base; protect top surface with layer of glass

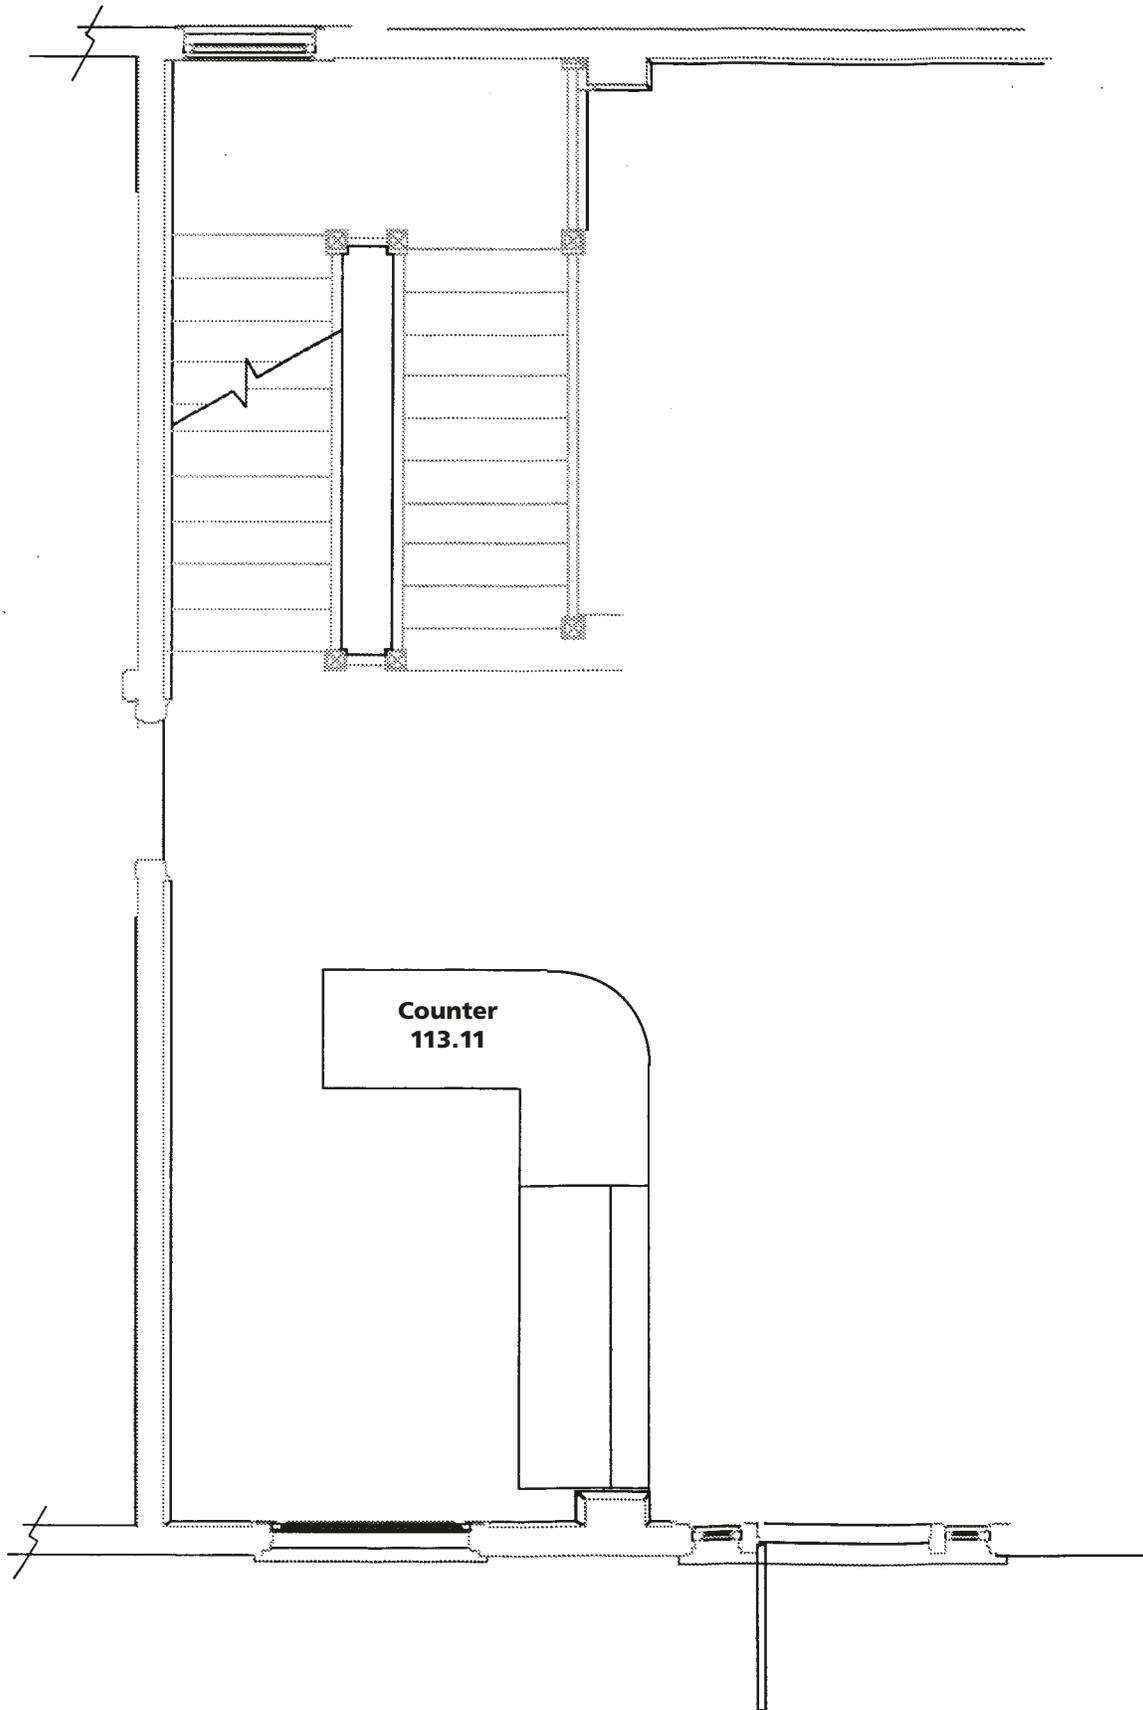

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
113.12	Cigar boxes, open for display, in glass display case portion of lobby counter	Figures 1, 2, and 32-3	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact
113.13	Cash register, electric, on short portion of counter, facing stairs	ICC Valuations, p. 72/333	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact; modern cash register will be used here
113.14	Desk, flat top, behind counter Figure 2,	ICC Valuations, p. 72/333	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact
113.15	Chair at desk along west wall	Standard furnishing associated with desk	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact
113.16	Safe, under short portion of counter	"Kelso Club Inventory," 1953	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact
113.17	Vending display case, ice-cooled along west wall at base of stairs, stocked with gum and candy	Packard	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact
113.18	Spittoon	Francis	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact
North wall			
113.19	Desk, flat topped, northwest corner by stairs, with chair	Figures 1-2; Packard recalled a round table	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact.
113.20	Radiator, north wall, in west corner by stairs	Figure 1	Omit. Installation would obstruct grilles of modern HVAC system.
South wall			
113.21	Radiator, south wall, in front of window behind lobby counter	Figure 1	Omit. Installation would obstruct grilles of modern HVAC system.
113.22	Calendar, Union Pacific, on south wall west of window behind counter	Figure 36	Acquire modern Union Pacific Railroad calendars annually. Adaptive reuse of lobby as MOJA visitors' center point of contact.

Lunch Room/"Beanery" Room 114

Like the adjoining lobby, the Kelso lunch room will serve multiple functions for the new Mojave visitors' center. It is thought that at some future date it may host a concession, and so, planning has moved forward to keep that as an option in the future.


These plans for the Kelso lunch room, then, reflect limited historic furnishings and the introduction of modern adaptations to meet present and anticipated park needs. While historic images of other Union Pacific Railroad lunch rooms show counters set for customers, Kelso Club employees from the 1920s-40s have noted that the counter was always kept clear, other than when in use.

For purposes of interpretation and complete documentation, this plan recommends that a setting for one be shown on the counter to suggest the presence of customers and display the type of place setting they would have used. It could be displayed in an angled case to protect and secure the objects. As Kelso Depot planning progresses, it may be decided that such a display might be more effective in another location, either in a free-standing base or in another exhibit area of the visitors' center.

45

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
114.1	Woodwork, stained and	Paint Analysis, p. 4 varnished	Refinish to original stain and varnish
114.2	Painted and varnished	Paint Analysis, p. 4 walls, buff beige	Paint Munsell 2.5Y 8.5/4, varnish
114.3	Painted ceiling, buff beige	Paint Analysis, p. 4	Paint Munsell 2.5Y 8.5/4, varnish
114.4	Floor, scored 12" concrete squares, maroon	Paint Analysis, pp. 4-5	Refinish to original maroon concrete
114.5	Ceiling fans, 2, four-blade, in center of beanery	Figures 2, 20-23, and 27; ICC Valuation, p. 73/333	Acquire (supplied by construction contractor per ARG specifications)
114.6	Lights, 4, hanging, with white opaque shades	Figure 37 <i>HSR</i> ; figures 1 and 20; ICC Valuation, p. 71/333	Acquire (supplied by construction contractor per ARG specifications)
114.7	Lunch counter, U-shaped, oak with cast iron feet plated with white porcelain and enamel "Carrara" glass top	Figures 1, 2, 20-22 and 25; ICC Valuation, pp. 72-3/333	Use extant original portions and reproduce remaining portion using Corian top (supplied by construction contractor per ARG specifications)
114.8	Stools, 33, high-backed wood swivel stools on white porcelain enamel base, bolted to floor in U-shape surrounding counter	Figures 1-2, 21-22, and 25; ICC Valuation, pp. 72-3/333	Acquire reproduction stools (supplied by construction con- tractor per ARG specifications); omit two stools at north end of west side to accommodate wheel chair access.


46

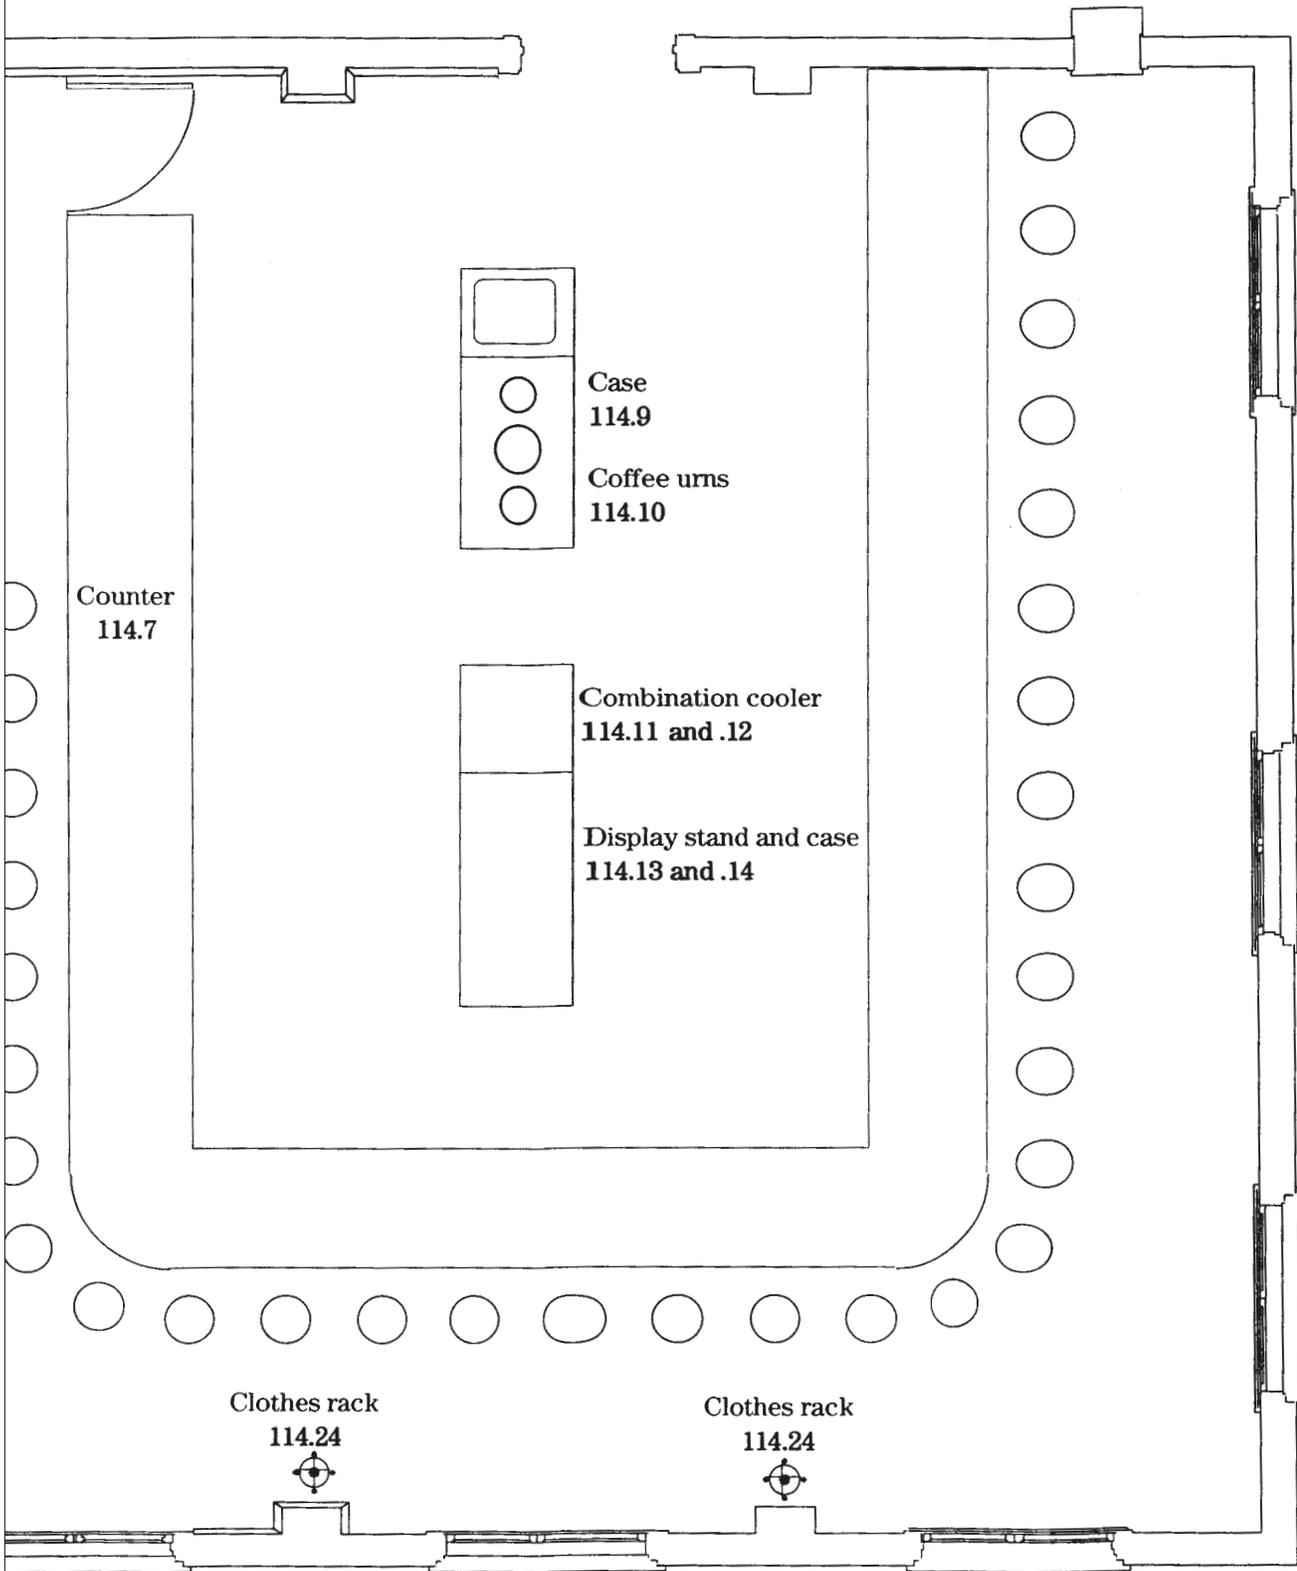

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
114.9	Base cabinet (combination urn stand and cup warmer) at north end of islands within lunch counter	Figures 1, 2, 13-22, 25, and 26; ICC Valuation, p. 72/333	Acquire reproduction base without cup warmer fitting inside (supplied by construction contractor per ARG specifications)
114.10	Coffee urns, 2 small, 1 large on combination stand, 114.9, with steam, waste and return drain	Figures 1, 2, 22, and 26; ICC Valuation, p. 72/333	Acquire
114.11	Stainless steel stand, north of display case in islands within lunch counter	Figures 2, 13-22, 25, and 26	Acquire
114.12	Combination cooler with cold water and waste drain on stainless steel stand, 114.11	Figures 1, 2, 13-23, 25, and 26; ICC Valuation, p. 72/333: "combination urn stand and cup warmer	Acquire
114.13	Display stand with Carrara top, southernmost in islands within lunch counter	Figures 1, 2, 13-23, and 25; ICC Valuation, p. 73/333	Acquire, use corian to replace Carrara top (supplied by construction contractor per ARG specifications)
114.14	Display case with glass sides, on top of display stand, 114.13	Figures 13-23, and 25; ICC Valuation, p. 72/333	Acquire reproduction (supplied by construction contractor per ARG specifications)
114.15	Salt and pepper	Figures 22 and 26	Acquire; display on counter or in another exhibition area
114.16	Sugar shakers	Figures 21, 22, and 26	Acquire; display on counter or in another exhibition area
114.17	Sample place setting with: glass, cutlery, Harriman blue dessert plate and coffee cup and saucer, linen napkin, ash tray ¹³⁵	Figures 21 and 25; Bunker, Packard	Acquire; display on counter or in another exhibition area
114.18	Menu, on counter with sample place setting	Figures 22 and 25	Acquire; display on counter or in another exhibition area
North wall			
114.19	Framed picture of western scene, north wall, west side	Figures 22, 34 and 35; Kelso Club Inventory, 1953; Packard: Sun Valley	Acquire
East Wall			
114.20	Framed pictures, 2, of western scenes, east wall between windows	Figures 22, 34 and 35; Kelso Club Inventory, 1953	Acquire
114.21	Radiators, 2, on east wall in front of north and south HVAC system.	Figures 1 and 25	Omit. Installation would obstruct grilles of modern windows

135 If in the future Kelso has a concession in the lunch room, plastic or paper plates that simulate the Harriman Blue china pattern would be a nice feature to provide.

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
South wall			
114.22	Radiators, 2, on south wall in front of east and west windows	Figures 1 and 25	Omit. Installation would obstruct grilles of modern HVAC system.
114.23	Coat/hat racks, 2, standing, along south wall by columns flanking center window	Figures 9, 13, 22, 24, and 25	Acquire
114.24	Air conditioners	ICC Valuation p. 12/17.	Omit. Adaptive reuse of lobby as MOJA visitors' center point of contact

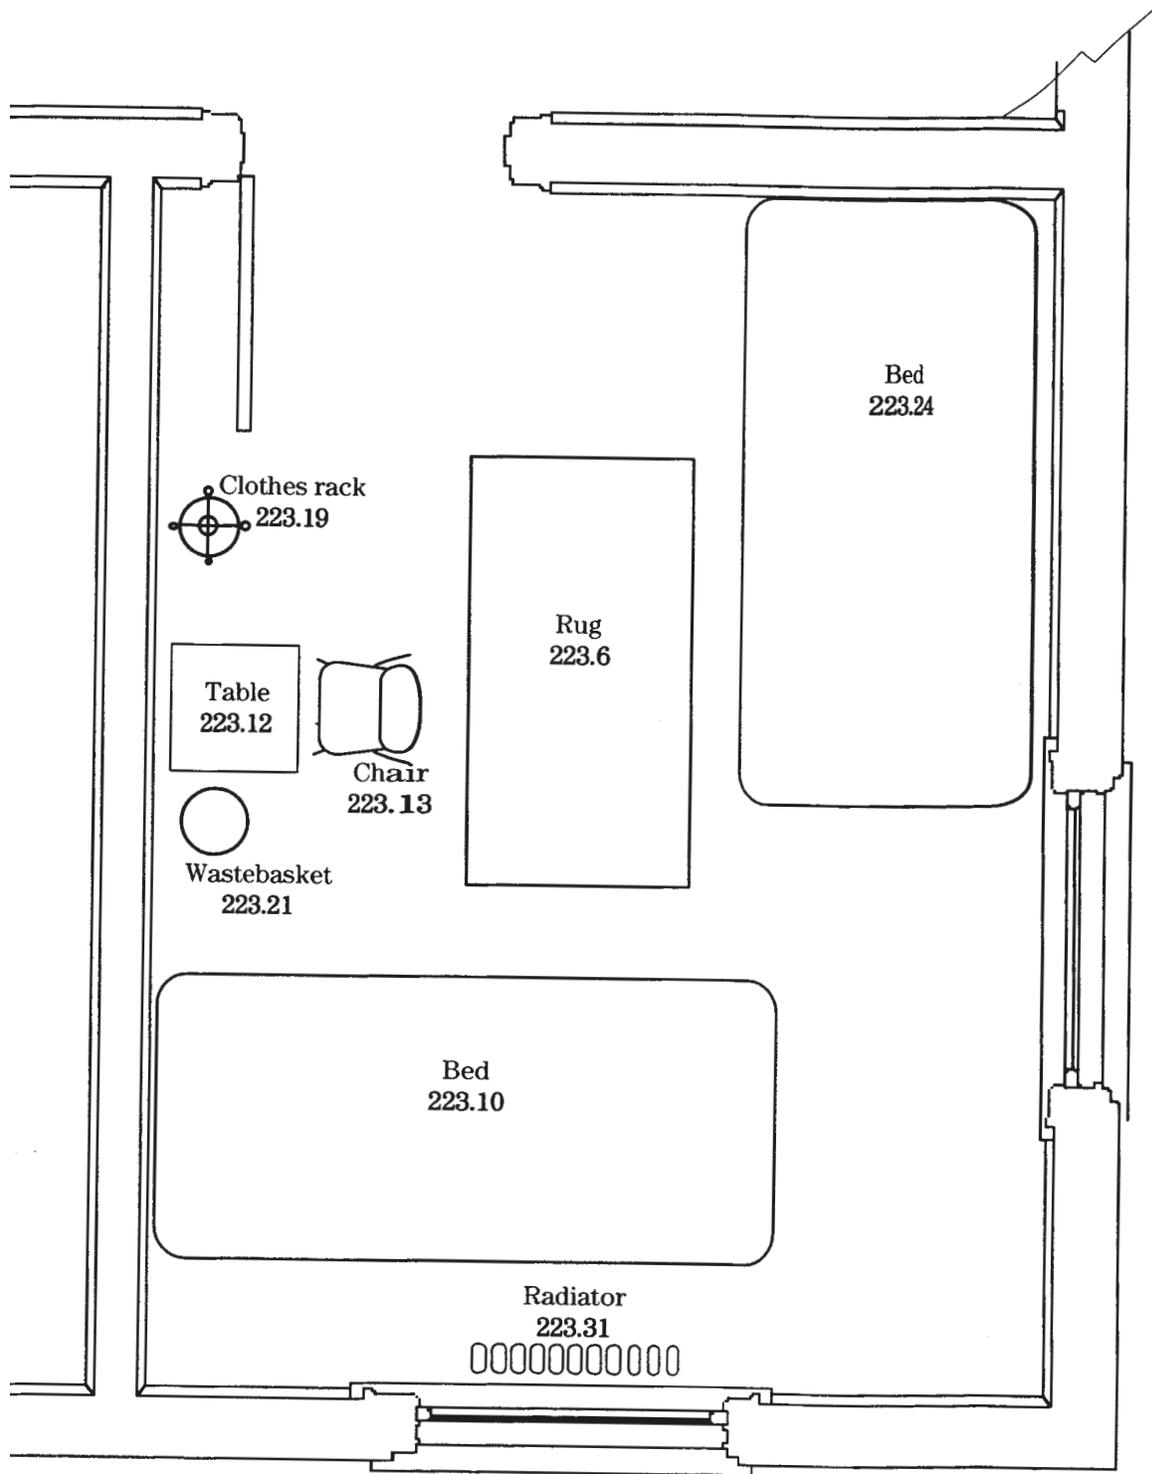

Railroad Crew Room Room 223


The twelve rooms on the south side of the Kelso Depot's second floor were designed and originally furnished as sleeping accommodations for Union Pacific Railroad crew. Over the years they were used by many Union Pacific employees working in the area but also by others in need of lodging while in Kelso.

The 1924-42 furnishings of this example of a crew room reflect the volume of use originally anticipated for the depot with two single beds in these rooms used by workers here on a temporary basis. While occasionally these rooms housed more than one person at a time, more often than not only one man stayed in them; this is reflected in the second, unmade, bed in the room. With no running water in the room, the bathroom down the hall was used for all washing, and towels etc. were hung on the hook on the back of the door. The suitcase, known in the 1920s and 1930s as a valise, indicates the temporary nature of a resident's stay in the room.

50

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
223.1	Woodwork, stained and varnished	Paint Analysis, p. 7	Refinish to original stain and varnish
223.2	Window sash, painted buff beige	Paint Analysis, p. 7	Paint Munsell 2.5Y 8.5/4
223.3	Walls, painted, caramel	Paint Analysis, p. 7	Paint Munsell 2.5Y 8/6
223.4	Ceiling, painted, buff beige	Paint Analysis, p. 7	Paint Munsell 2.5Y 8.5/4
223.5	Floor, stain and varnish		Refinish to original
223.6	Rug, Axminster, 2'3" x 4'6"	ICC Valuation p. 73/333	Acquire reproduction
223.7	Ceiling-mounted light, with white opaque shade	Figure 37 <i>HSR</i> ; figure 3; ICC Valuation, p. 71/333	Acquire (supplied by construction contractor per ARG specifications)
223.8	Roller shades, 2, off-white	Figure 19; physical evidence of shade hardware	Acquire reproductions
223.9	Window curtains, 2 pair	Figure 19; physical evidence of curtain hardware	Acquire reproductions
West wall			
223.10	Bed, steel frame, with head near south end of west wall, projecting out into the room	Figures 12 and 13; ICC Valuation p. 73/333, Simmons	Acquire
223.11	Mattress, felted unmade, on bed 223.	ICC Valuation pp.71 and 73/333	Acquire
223.12	Table, steel, 16" x 16" along west wall south of open door	ICC Valuation p. 73/333; Simmons	Acquire
223.13	Chair, fumed oak, at table on west wall	ICC Valuation p. 73/333	Acquire
223.14	Toothbrush, on table	Standard furnishing for bedroom of this sort	Acquire

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
223.15	Small note pad, pen on table	Standard furnishing for bedroom of this sort	Acquire
223.15a	Railroad pass on table	Standard furnishing for bedroom of this sort	Acquire
223.16	Ash tray on table	Common bedroom furnishing, 1924-42	Acquire
223.17	Flashlight on table	Common furnishing for worker's bedroom	Acquire
223.18	Calendar, tacked to west wall above table	Standard furnishing for bedroom of this sort	Acquire
223.19	Clothes rack, steel, along west wall just north of table	ICC Valuation, p. 73/333 "Simmons No. 21 steel costumier"	Acquire
223.20	Work jacket, on 223.	Standard furnishing for bedroom of this sort	Acquire
223.21	Waste basket, metal, along west wall south of table	Kelso Club Inventory, 1953, p.1, likely furnishing, probably overlooked in 1924 ICC Valuation	Acquire
North wall			
223.22	Door hooks, 2, mounted on back of door	Originals extant	Use originals from room 223 or from another room along the south side of the building
223.23	Towel and washcloth, hanging on hooks on back of door	Standard furnishing for bedroom of this sort	Acquire
223.24	Bed, steel frame, with head at east end of north wall, projecting out along east wall	Figures 12 and 13; ICC Valuation p. 73/333, Simmons	Acquire
223.25	Mattress, felted, on bed 223.	ICC Valuation pp.71 and 73/333	Acquire
223.26	Blanket, monogrammed, on bed	ICC Valuation p. 73/333: '66" x 84"	Acquire reproduction with Union Pacific monogram
223.27	Pillow, sheets, pillow case on bed	Kelso Club Inventory, 1953 p. 9 notes pillows	Acquire reproductions
223.28	Work boots, on floor by bed	Standard furnishing for bedroom of this sort	Acquire
East wall			
223.29	Picture, tacked to east wall along side bed	Standard furnishing for bedroom of this sort	Acquire
223.30	Valise, on floor by foot of bed along east wall	Standard furnishing for bedroom of this sort	Acquire
South wall			
223.31	Radiator, on south wall in front of window	Figure 3	Acquire

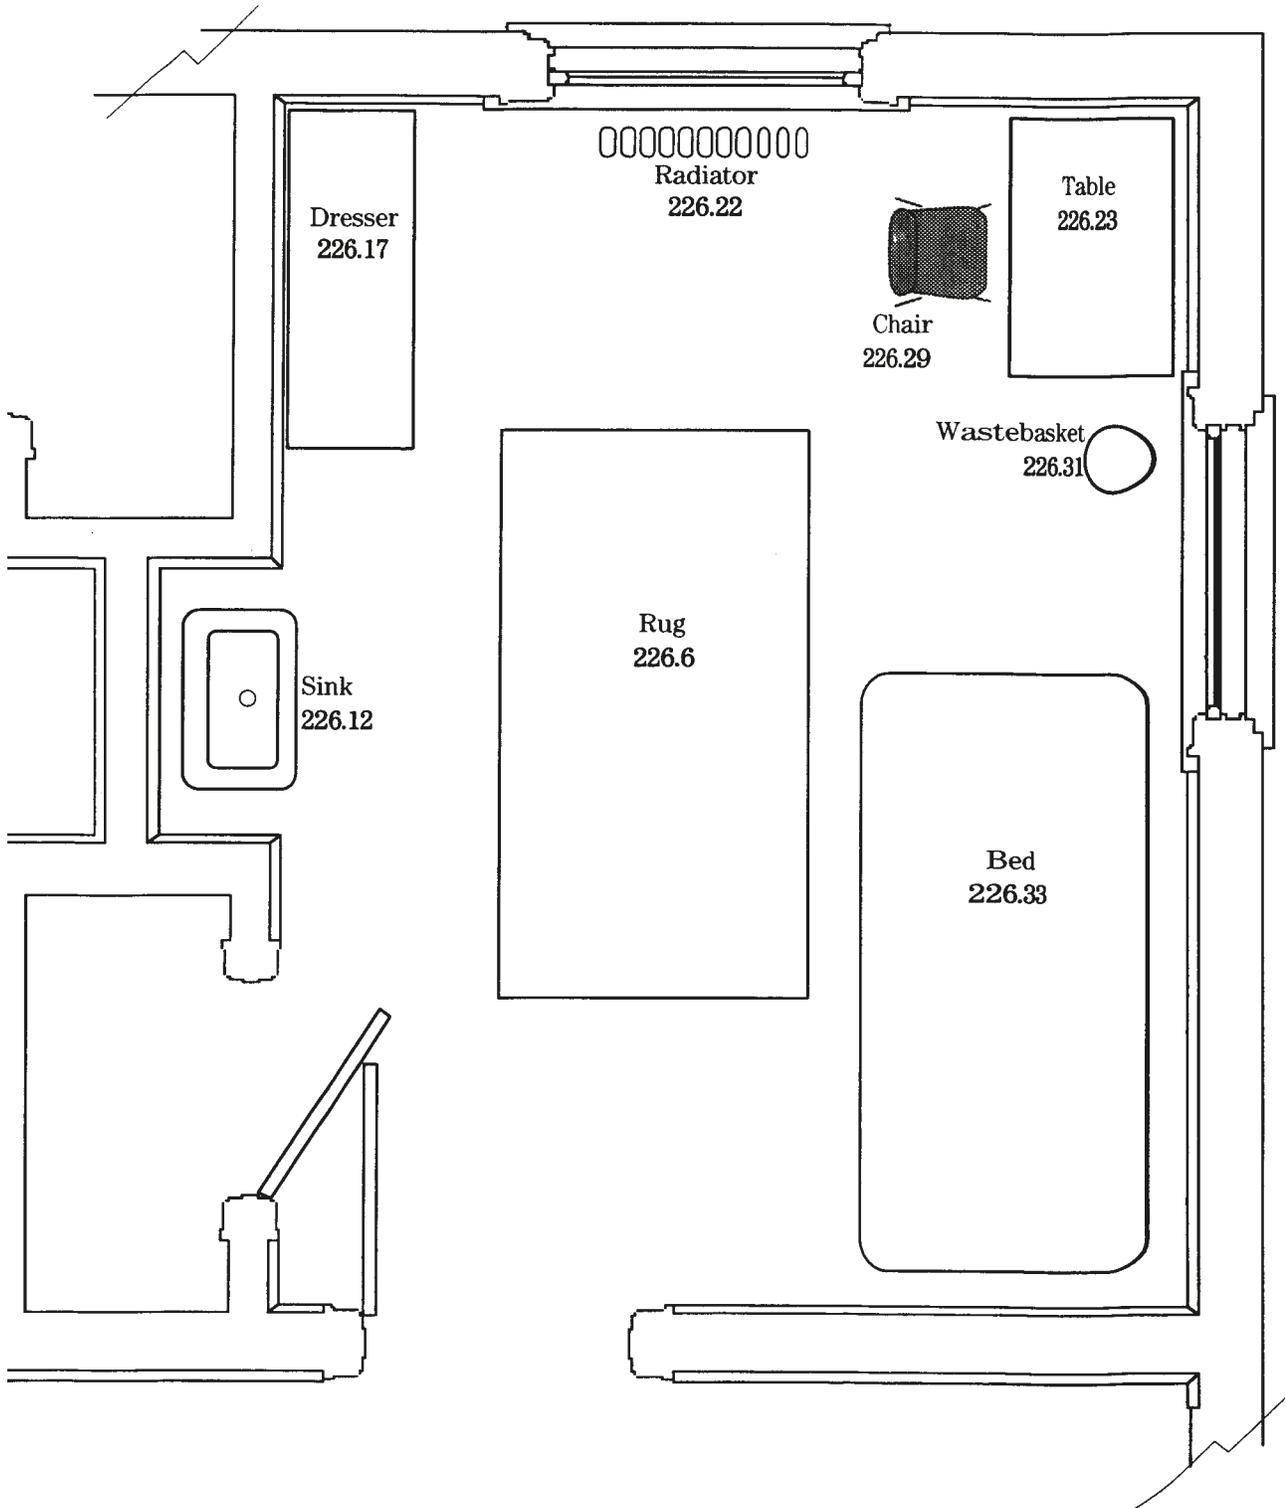

Male Help Room Room 226

Kelso Depot had eight male help rooms on the north side of its second floor, providing living quarters for Union Pacific Railroad workers living at Kelso but not in need of a house or a room in a house. Most commonly, these rooms were occupied by single men who worked in the Kelso Club.

The historic furnishings of this male crew room are based upon furnishings listed in the original 1924 inventory of the building and also reflect historic furnishings characteristic of the period and the type of person occupying these rooms. Residing in the Kelso Club on a semi-permanent basis, those who lived here had sinks and closets in their rooms, a dresser, just one bed, and a slightly larger table and rug than in the rooms across the hall.

53

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
226.1	Woodwork, stained and	Paint Analysis, p. 7 varnished	Refinish to original stain and varnish
226.2	Window sash, painted, off-white	Paint Analysis, p. 7	Paint Munsell 2.5Y 9/2
226.3	Walls, painted, caramel	Paint Analysis, p. 7	Paint Munsell 2.5 Y 8/6
226.4	Painted ceiling, caramel	Paint Analysis, p. 7	Paint Munsell 2.5 Y 8/6
226.5	Floor, stain and varnish		Refinish to original
226.6	Rug, Axminster, 3'x6' in center of room	ICC Valuation p. 73/333	Acquire reproduction
226.7	Ceiling-mounted light, with white opaque shade	Figure 37 <i>HSR</i> ; figure 3; ICC Valuation, p. 71/333	Acquire (supplied by construction contractor per ARG specifications)
226.8	Roller shades, 2, off-white	Figure 19; physical evidence of shade hardware	Acquire reproduction
226.9	Window curtains, 2 pair	Figure 19; physical evidence of curtain hardware	Acquire reproduction
West Wall			
226.10	Towel rack, mounted on front of closet door, west wall	Extant mounted on closet door	Use extant original
226.11	Towel and wash cloth, hanging on towel rack	Standard furnishing for bedroom of this sort	Acquire
226.12	Sink, porcelain, built-in, wall in recess along west	Extant original	Use extant original
226.13	Glass tumbler on sink	Standard furnishing for bedroom of this sort	Acquire
226.14	Toothbrush and toothpaste on sink	Standard furnishing for bedroom of this sort	Acquire
226.15	Mirror, above sink on east wall	Standard furnishing for bedroom of this sort	Acquire
226.16	Light fixture, wall mounted, above sink on west wall	Figure 3; ICC Valuation p. 71/333; extant original	Acquire (ARG)

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
226.17	Dresser, steel, along west wall at north end	ICC Valuation p. 73/333, No. 109 Simmons	Acquire
226.18	Dresser scarf on dresser	Standard furnishing for bedroom of this sort	Acquire
226.19	Comb, pocket watch, soap and soap dish on dresser	Standard furnishing for bedroom of this sort	Acquire
226.20	Photographs, 2 in table top easel frames on dresser	Standard furnishing for bedroom of this sort	Acquire
226.21	Razor, shaving brush, soap, and mug on dresser	Standard furnishing for for bedroom of this sort	Acquire
North Wall			
226.22	Radiator, on north wall in front of window	Figure 3	Acquire
East Wall			
226.23	Table, steel, 21" x 32" on east wall at north end	ICC Valuation p. 73/333; Simmons	Acquire
226.24	Desk blotter on table	Standard furnishing for bedroom of this sort	Acquire
226.25	Stationary and envelopes on table	Standard furnishing for bedroom of this sort	Acquire
226.26	Pen, ink bottle, blotter paper, pen wiper on table	Standard furnishing for bedroom of this sort	Acquire
226.27	Calendar, table top on table	Standard furnishing for bedroom of this sort	Acquire
226.28	Letter holder with a few letters received on table	Standard furnishing for bedroom of this sort	Acquire
226.29	Chair, fumed oak at table along east wall	ICC Valuation p. 73/333	Acquire
226.30	Picture from Union Pacific calendar, tacked to wall above table	Standard furnishing for bedroom of this sort	Acquire
226.31	Waste basket, metal, along east wall south of table	Kelso Club Inventory, 1953, p.1; likely furnishing, probably overlooked in 1924 ICC Valuation	Acquire
226.32	Framed picture on east wall above bed	Standard furnishing for bedroom of this sort	Acquire image of railroad or western scene

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
South Wall			
226.33	Bed, steel frame, with head at south wall, projecting along east wall	Figure 12; ICC Valuation p. 73/333, Simmons	Acquire
226.34	Mattress, felted, on bed 223.	ICC Valuation pp.71 and 73/333	Acquire
226.35	Blanket, monogrammed, 66" x 84"	ICC Valuation p. 73/333	Acquire period or reproduction with Union Pacific monogram
226.36	Pillow, sheets, pillow case	Kelso Club Inventory, 1953 p. 9 notes pillows	Acquire
226.37	Book, <i>The Union Pacific Trail: A Novel</i> , Zane Grey, 1918, on bed	Likely furnishing for bedroom of this sort	Acquire

Select Exterior Furnishings

HFR #	OBJECT AND LOCATION	EVIDENCE	RECOMMENDATION
EXT.1	Baggage cart, on west arcade near baggage room or along front near track	Figure 16	Use original presently at Mojave Desert Museum; secure to arcade floor or column
EXT.2	Sign, "Western Union," on façade in front of telegraph office	Francis, 5/25 and 7/18/00	Acquire reproduction
EXT.3	Sign, "Railway Express Agency," on façade in front of telegraph office	Francis, 5/25 and 7/18/00	Acquire reproduction
EXT.4	Train bulletin board, in bay of front arcade	Figures 10 and 11	Acquire reproduction
EXT.5	Sign, "Lunch Room," projecting perpendicular to front arcade	Figure 5	Acquire (supplied by construction contractor per ARG specifications); see 95% Construction Drawings, A44

